

Responsible: D. Rutz  
Date: 12.02.2008

Tel.: (0209) 401 733  
Fax: (0209) 401 743



**Touch Control error readout**  
**Spare-part no. 528 836 and 528 815**

**Model: EKI 957.0**

Error code	Description	Measure
C04	Reset after power cut > 2 min.	
F1	Temperature sensor induction coil short circuit, front	Replace the temperature sensor or the induction module
F2	Temperature sensor induction coil discontinuation, front	Replace the temperature sensor or the induction module
F3	Temperature sensor induction coil short circuit, rear	Replace the temperature sensor or the induction module
F4	Temperature sensor induction coil discontinuation, rear	Replace the temperature sensor or the induction module
F5	Electronic unit temperature sensor short circuit	Replace the temperature sensor or the induction module
F6	Electronic unit temperature sensor discontinuation	Replace the temperature sensor or the induction module
F7	Overheating of the electronic unit	Allow the hob to cool down, check ventilation if necessary
F8	Induction coils of the temperature sensor at the front and rear have switched off	
F9	Under-voltage < 165 V	