

Responsible: D. Rutz
Date: 12.03.2009

Tel.: (0209) 401 733
Fax: (0209) 401 743



Configuration of the EKI domino hob (30 cm) touch control Rectifying error message "E 4"

Configuration can be triggered within two minutes of applying power. The controls are not switched on here. The displays all remain dark.

Accessing the service menu

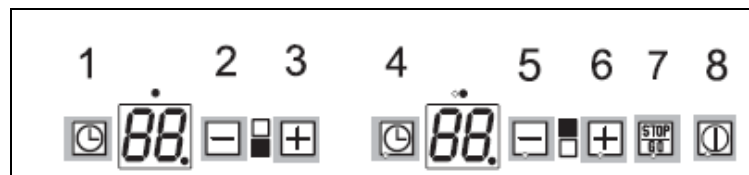
In order to protect the service menu from unintentional access by the user, the settings are only accessible for 2 minutes after a reset.





 

The controls must be off and no egg timer may be activated.

Errors specific to the hob and general errors may be live, since entering the service menu may be necessary in order to rectify these errors (incorrect configuration).

Important!

Each time a key is pressed together with key 7 (Stop and Go) when it is already being pressed, a key will bleep in acknowledgement. The next key must be pressed within 1 second of the last press of a key each time. A short double bleep will sound as soon as the sequence or the timing are not observed. Entry will be discontinued and the controls will remain in the off status.



1. Press the Stop and Go key  (7) and keep it pressed.
2. Now press the  key (1).
3. Then press keys  (2),  (3),  (5) and  (6) in sequence.

Please note! If the hob on the left is not present, the keys for the hob on the right will be used for entry.

4. A "C" symbol will appear on keys 2 and 5.
5. Then proceed the same as for basic configuration as described in technical information T1-88-05.