

Responsible: D. Rutz
Date: 3.07.2006

Tel.: (0209) 401 733
Fax: (0209) 401 743



Snorkel noise or high rumbling sound during operation IGV 645...

After a short time the spray pump will seemingly drive slower and the sound goes down. After the warming up of the water the bend slip in and close the flow rate. Strange snorkel noise is to hear.

Cause:

The bend hose is mounted wrong.
To high tension at the bend through misaligned assembling.



Remedial action:

Inspect the correct suit of the bend hose. Observe if the bend will slip in and collapsing.



Slightly pushing with a screwdriver can help. Or you switch the dishwasher off and on during the cycle.

If the bend slip in - change the bend. It doesn't help to reassemble the bend in the correct way. The bend is deformed and only for changing.



Spare parts:

1 x Bend 12NC: 43 47 58

2 x Strap 12NC: 43 47 84

Change when necessary the foam rubber at the Ascoll synchron motor.

Spare part number: 43 53 68

Assembling:

Take care that you fit at first the sump side and then the heater side. Be sure that is no tension on the bend hose.