

Responsible: U. Laarmann
Date: 30.03.2006

Tel.: (0209) 401 732
Fax: (0209) 401 743

**IKEF 308-5 Z 3 - PNC: 925 703 659****EMZ 26 CLC COMPRESSOR DOES NOT FUNCTION
(PROTECTIVE MOTOR SWITCH DEFECT)**

For the IKEF 308-5 Z 3 (appliances up to series number 605xxxxx), the EMZ 26 CLC compressor (spare-part no. 432 769) functions properly under normal circumstances. In the event of a power cut the compressor may not switch on again.

This is due to a defect TSD protective motor switch. The fault does not lie with the compressor itself.

Carry out the following steps in order to rectify the problem and help customers at short notice:

1. Disconnect the appliance from the power supply for approx. 40 minutes.
2. Switch the appliance on again.

The protective motor switch will work properly again once the compressor has completely cooled down.

The protective motor switch must definitely be replaced. It can be ordered under spare-part no. 43 27 71.

You can use this number on the nameplate to see whether a new protective motor switch needs to be installed.

