


Replacement of the cooking zone temperature sensor (spare-parts no. 538 216) on the EKI

This description merely serves to help trained customer service staff and is therefore greatly simplified!

A defective sensor is replaced as follows:

As shown in the following picture, carefully raise the insulation of the cooking zones where the sensor is defective and pull the sensor out through the opening in the centre of the insulation.

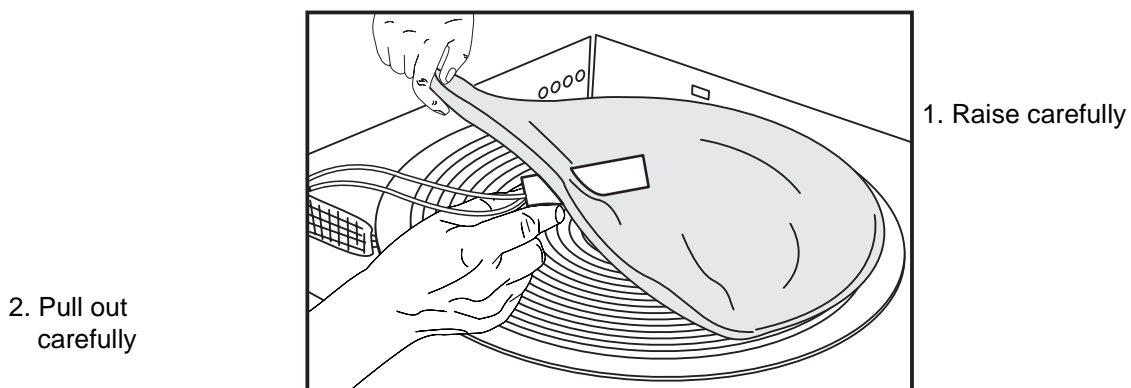

The remaining procedure varies depending on the cooking zone.

Defective sensor at front left

