

Responsible: Dieter Rutz
Date: 07.09.2011

Tel.: (0209) 401 733
Fax: (0209) 401 743



Warming drawers with push technique: Vertical front door misalignment

Models involved: WS 6014.0 BC, WS 6014.1E, WS 6014.1GE, WS 6015.1E, GA-15 lx


Production date: after week 09/2011

Serial number: after R 03 04 09 nnnn

New Internal Squares to assure a more stable front drawer and to assure a right vertical alignment. These new Squares are applicable in all drawers in the field, and could be used to solve vertical front door misalignments.

The squares are applicable in all listed models in the field.

1. Remove the three screws that are fixing the tray to the slider and the back door cover to the front (both sides).
2. Place the square in position and apply the two screws on the back door cover. Repeat this action on the opposite side.
3. Apply the screw on the tray and slider.

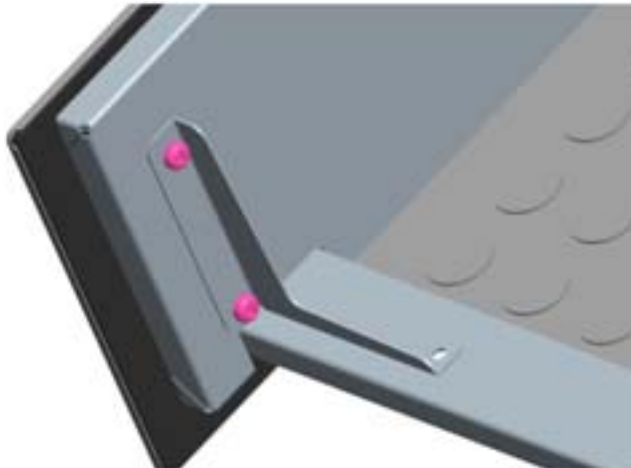

Right square spare-part no. 544519
Left square spare-part no. 544520