

Responsible: D. Rutz
Date: 25.02.2011

Tel.: (0209) 401 733
Fax: (0209) 401 743



Door noise for all ovens with a pyrolysis function

New clasps

When the pyrolysis function is operating, the glass in the door expands. This needs to be taken into account when developing the holders.

These clasps allow the glass to move up to a certain point. When the door is closed a noise that the customer will hear is produced.



This part was improved in production up to January 2010 and reinforced so that the glass is held better. This reinforcement reduced the movement of the glass pane.

The plastic clasps are available under the following **spare-part numbers: 543597** (left) and **543596** (right).

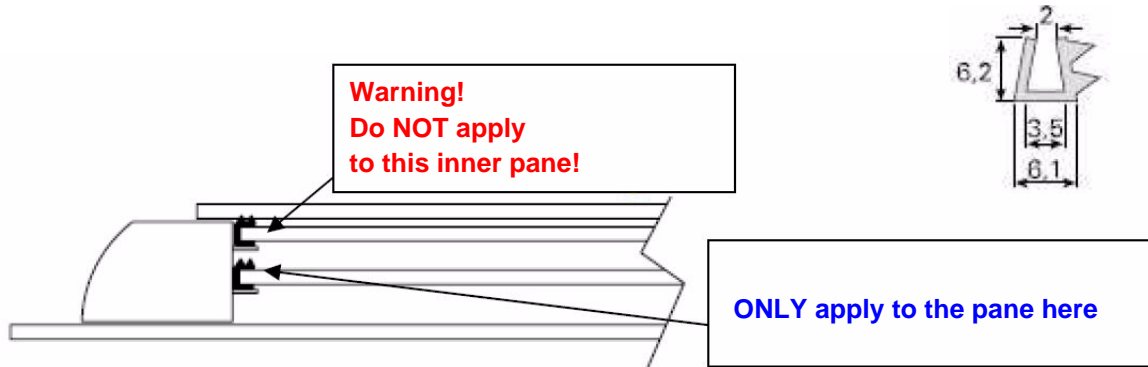


New reinforced clasp

Old clasp

New sealing - spare-part no. 3130668**Triple glazing**

Please apply the profile packing all around the third inner pane as shown in the illustration.

**4-pane glazing**

The profile packing surrounding the pane may **ONLY** be applied to the second pane as the silicone dissolves at 300°C.

Glass pane with sealing