

Responsible: Dieter Rutz
Date: 12.08.2005

Phone: (0209) 401 733
Fax: (0209) 401 743




Concerns: **EMWG 9500.0 and EMWK 9500.0**
all of the appliances produced before calendar week 05/13

Complaint: **Cooling fan starts up automatically after 10 minutes when the timer function is activated**

If the timer function is used for longer than 10 minutes, the cooling fan will start up automatically. In order to prevent this from occurring, the EEPROM of the KAG control circuit board, spare part no. 531 318, was provided with new software.

The new software version commences with the 05/13 production week in all of the control circuit board EEPROM's. The production date of the printed circuit boards can be seen above the label on the EEPROM.

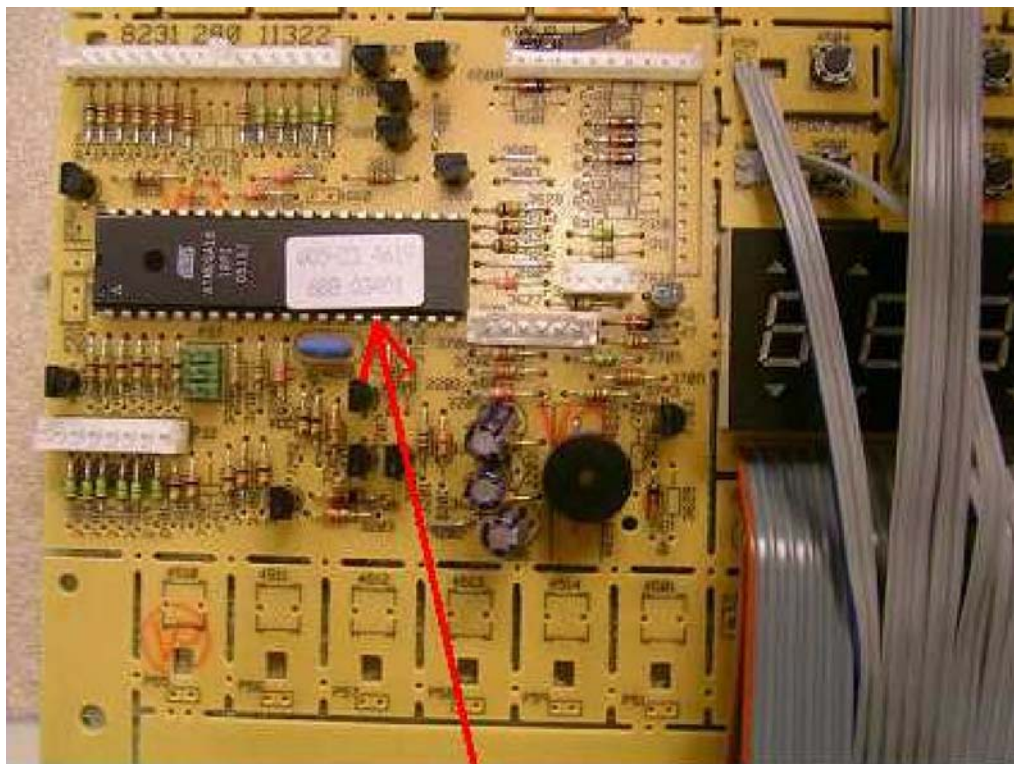

In this example the production date of the printed circuit board is W05-23
(05 = year, 23 = CW 23)