

Bearbeitung: Uwe Laarmann
Datum: 14.11.2013

Telefon: (0209) 401 732
Fax: (0209) 401 743

Austausch des Abluftstutzens aus Metall gegen eine geänderte Version aus Kunststoff

Betrifft Modell: MWGD 750.0

Fehlerbild:

Bei Änderung der Leistungsstufen erfolgt keine Änderung der Motordrehzahl. Das Laufgeräusch bleibt auch bei Änderung der Leistungsstufe immer gleich. Die Saugleistung ist ungenügend.


Abluftstutzen neu ET-Nr. 545885.



Achtung!

Der neue Abluftstutzen ist um 96mm höher als der alte. Abhängig von der Abluftführung ist deshalb die Montage des geänderten Stutzens nicht immer möglich.

Der Abluftstutzen aus Kunststoff wird mit vier Schrauben befestigt.

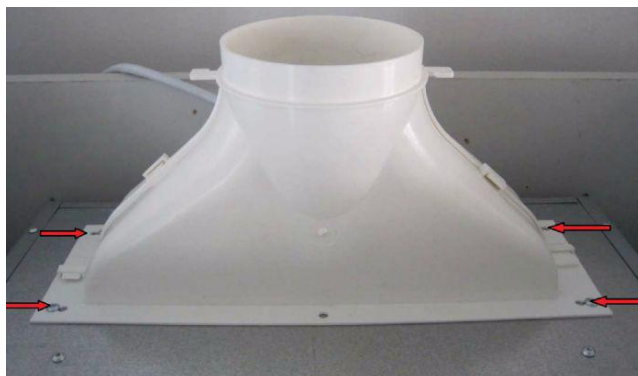

Replacing the metal air vent with a modified plastic version Concerns model: MWGD 750.0

Spare-parts n. 545885

Error pattern:

The motor speed does not change when the power levels are changed. The noise made during operation stays the same, even when the power level is changed. The suction power is not strong enough.



Important!

The new air vent is around 96mm taller than the old one. It is thus not always possible to install the modified air vent; this depends on the outgoing air duct.

The plastic air vent is secured with four screws