

## Working instructions for repositioning or replacing loose or defect glass panels

### Repair kit, spare-part no. 544124

The glass panels of some of the following hoods may become loose:

KD9875.0 GE KD9875.1GE KD9875.0PW KD98751PW IKD3800.0GE IKD9880.0GE IKD7800.0PW  
KD9880.0GE KD9880.0PW

The example of the following working instructions shows you how you can re-attach the loose glass. Should you need a new glass panel, it can be ordered in the customer service centre by telephone.

**The required industrial fan must be requested in an order from the customer service centre and is to be returned when the work has been completed!**

1. Remove the glass panel with an industrial fan.
2. Clean both the surfaces that are to be bonded (glass and hood) with the special fat solvent contained in the set.
3. Cut the double-sided adhesive tape as illustrated and adhere it.



#### ATTENTION!

Leave a clearance of at least 5 mm in width around the edge of the glass when adhering the double-sided adhesive tape.

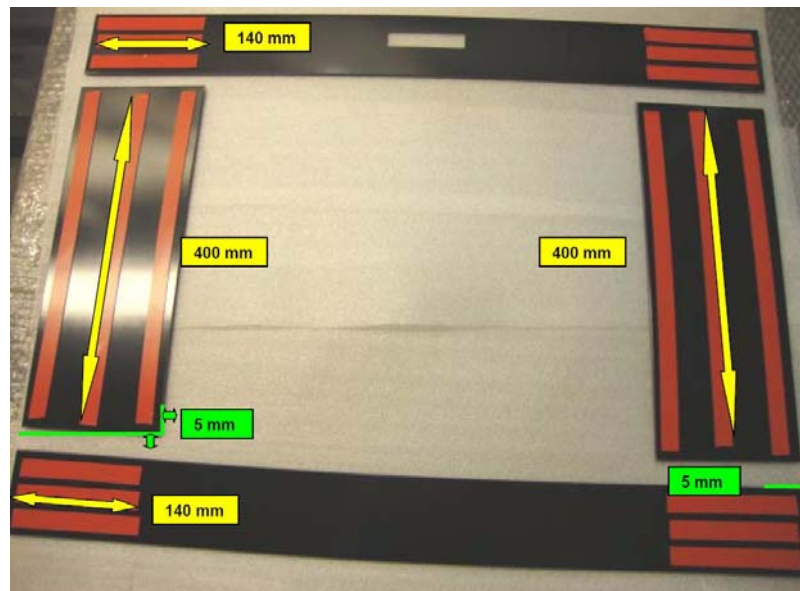
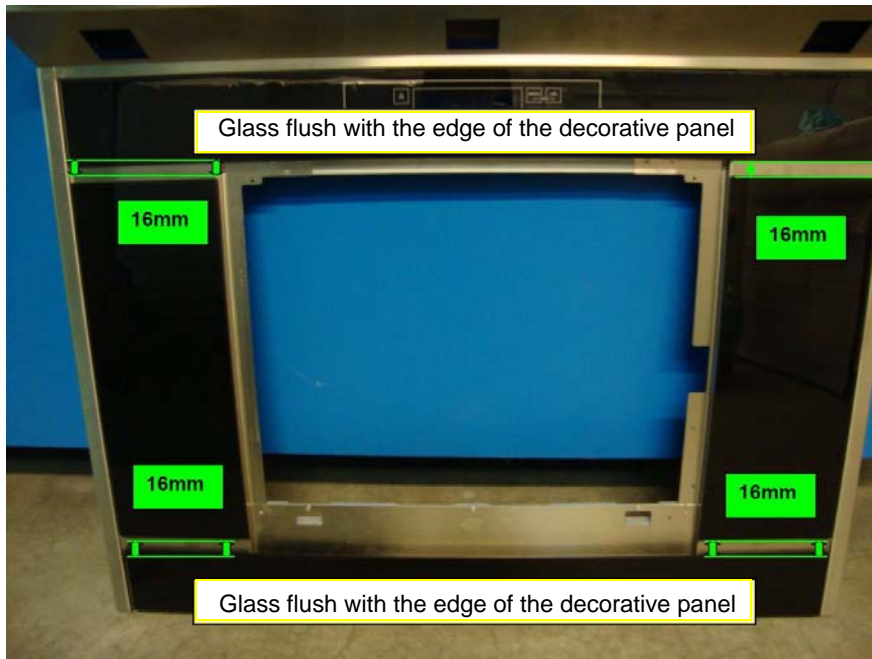


Abb. 1: Adhering the adhesive tape

4. Press the strips of adhesive tape on firmly to make sure that they stick properly.

5. Fasten the glass as shown below.



*Abb. 2: Fastening the glass panel*