Responsible: D. Rutz Tel: (0209) 401 733 Date: 20.12.2004 Fax: (0209) 401 743



## New softening equipment for all 45cm and 60cm dishwasher models with a TURBO dryer (fan)

As of serial number 347 ... (November 2003) a new rinsing chamber with a new support at the top is being introduced for some of the dishwashers produced.

The modification is being carried out in order to improve the system.

Using a hose which connects the softening equipment supports with the bottom of the dishwasher makes it easier for the condensation water at the top of the condensation cycle to drain off, hence improving the drying process.

The water that collects in the left water collector on the bottom of the dishwasher can thus evaporate.

Description	Pos.	Quantity	Spare-p.n.	110B
Hose	110B	1	435 375	
	140	1	435 394	
				1300

The new softening equipment can only be replaced with the specific kit and if the steps described in the following "instructions for technicians" are followed.

The new spare-part no. 435 114 (large softening equipment for electronic appliances) is therefore replaced with this kit.


## Instructions for technicians

In order to replace the softening equipment, please:


- a. Remove the vapor discharge screen from the inside of the container.
- b. Remove the base and the lower front cover.
- c. Remove the left side panel.
- d. Remove the hose that connects the softening equipment to the water intake valve.
- e. Carefully lift up the drying duct and loosen the softening equipment. Make sure that
  - o the sponge gasket located between the softening equipment and the drying duct is not damaged;
  - o the cable leading to the fan motor is not damaged.


2/2 H7-410-03-25

Carefully pull the softening equipment upwards in order to avoid damaging the O rings between the softening equipment and the pan.

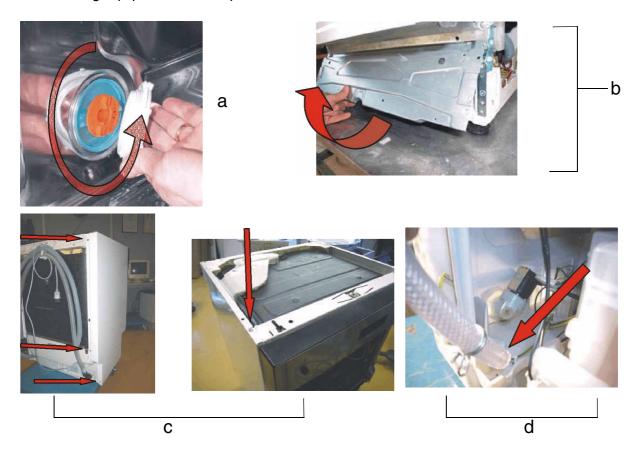

- f. Connect the hose to the softening equipment.
- g. Instal the new softening equipment. In order to do so carry out the individual steps for removal in reverse. Make sure that the hose is lead into the water collector at the bottom of the dishwasher.
- h. Carry out a test program after installation and prior to mounting the top of the dishwasher again.
- i. Mount the remaining parts..

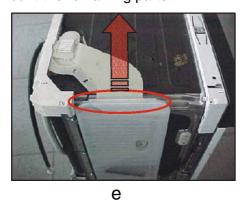

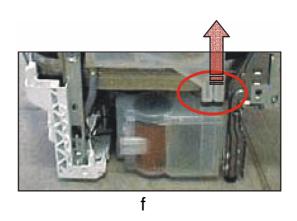

Note! When re-mounting, lubricate the O rings and fit them exactly. Make sure that the flow in the hose is not blocked off anywhere between the pan itself and the side panel.