

Responsible: Uwe Laarmann  
Date: 20.07.2004

Phone: (0209) 401 732  
Fax: (0209) 401 743



### Zero-degree drawer too cold

Due to the problems which have occurred with the zero-degree appliances, the factory has undertaken some modifications as of serial no. 422xxxxxx in order to solve these problems, which concern the excessively low temperature in the zero-degree compartments.

Two kits (one for the 4\*\*\*\* appliance and one for the cooler) were put together for appliances produced prior to the serial number indicated above. This means that previous models have the same properties as the new models.

The sets are to be ordered as follows, depending on the model in question.

Date	Model	Spare-part no. kit
14.5.2004	IKEF 238-5	43 24 26
14.5.2004	IKEF 248-5	43 24 27

Customer service set for 0° \*\*\*\*

Quantity	Specification	Spare-part no.	Ill.
1	New display electronics	43 24 20	
1	Grid, soft wire, top drawer	43 24 21	A
1	Grid, soft wire, bottom drawer	43 24 22	B
1	Separator, soft wire, top drawer	43 24 23	C
1	Protective casing, air passage modified	43 24 24	D
1	Polystyrene screen modified	43 24 25	E

Kundendienstsatz für 0° Cooler

Quantity	Specification	Spare-part no.	Ill.
1	New display electronics	43 24 28	
1	Grid, soft wire, top drawer	43 24 21	A
1	Grid, soft wire, bottom drawer	43 24 22	B
1	Separator, soft wire, top drawer	43 24 23	C
1	Polystyrene screen modified	43 24 25	E

### Interchangeability

The former separator in the top drawer can no longer be used.

Illustration A

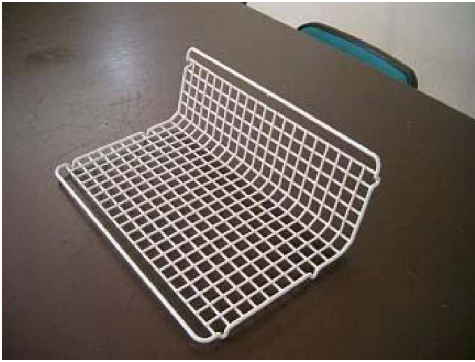


Illustration B



Illustration C



Illustration D



Illustration E



Zero-degree drawer too cold