

## New came and new inner door frame in compact microwaves ovens

### MODELS

MW 32 BIS - MW 32 BIT and MC 32 BIS

### INTRODUCTION

All microwave ovens produced after 06-11-2007 (Came) y 30-11-2007 (Inner Door Frame).

Serial numbers up to H45cccccc0163 (new came) and H49cccccc0001 (Inner Door Frame New version)


### DESCRIPTION

The following parts was improved with the objective to assure a good working stability:


- Came - lever length increased 1 mm;
- Inner Door Frame - Thickness increased, to assure permanent contact between Came/Hook during door opening operation. With this configuration remains assured came rotation independently of hook position.

### PROCEDURE

- Came turned to the safety position in a consequence of reduced inter-action between hook and came. In consequence of this fast movement were identified occurrences of spring out of position.
  - Microwave stop during normal use in consequence of instable micro switches action
1. Replace Right Came and Left Came for a new ones

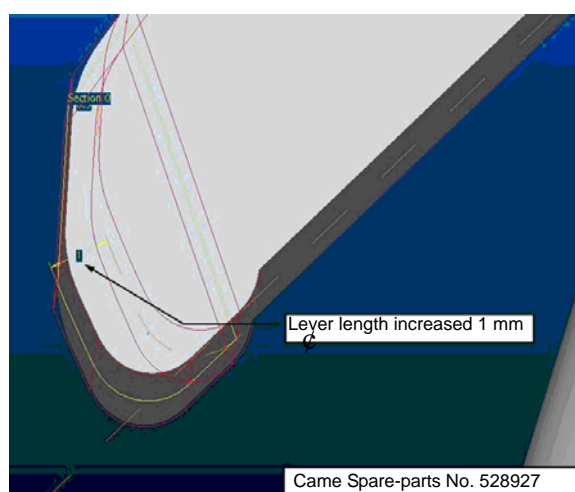

2. Replace Inner Door Frame for a new version  
Thickness increased 1mm and base reinforced.

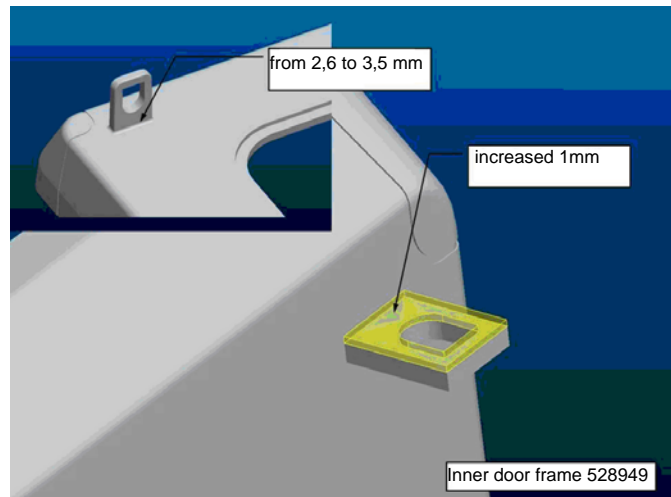



With these improvements we assure an adequate mechanical action on the came resulting a good working stability. Extreme working positions will be controlled by the hook without the possibility of came returning to the safety position after hook freedom.

Hook configuration more strong, reducing accidental broken occurrences

#### **Spare-parts numbers**

Inner door frame: 528949

Came: 528927

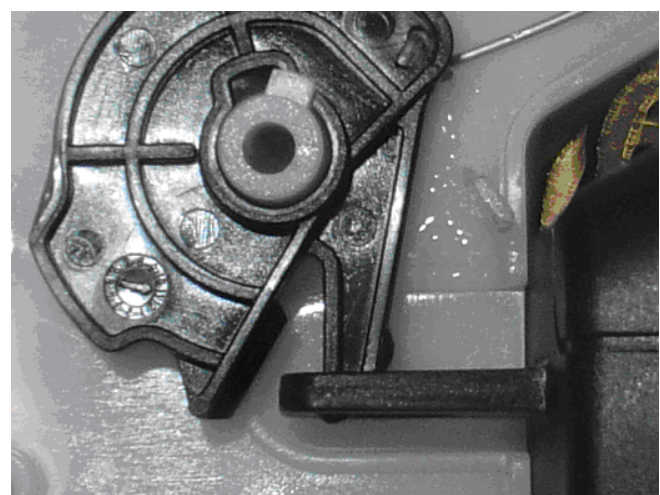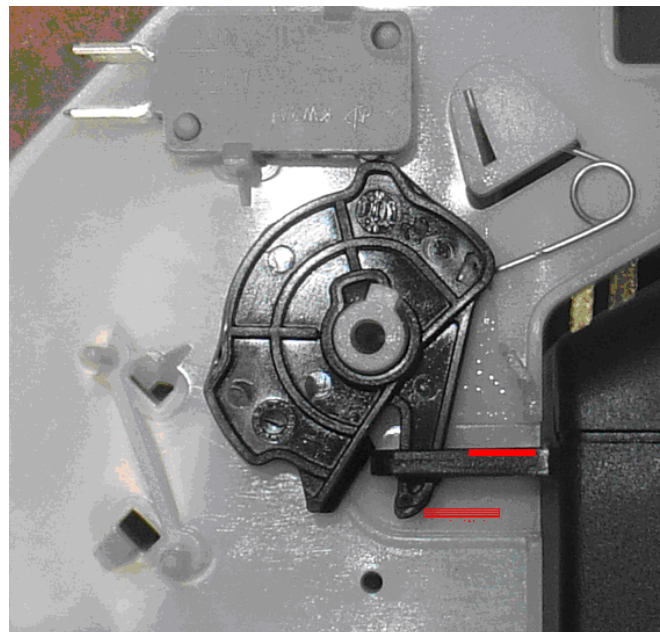

#### **INTERCHANGEABILITY**

Both pieces are interchangeable on the appliances on the market.