

Bearbeitung/ *Responsible*: Dieter Rutz
Datum / *Date*: 25.02.2013

Telefon: +49 (0)209 401-733
Fax: +49 (0)209 401-743




IGV/IGVS 6610.0/1 Zeolith-Gerät heizt nicht

Fehler: Nach Programmende ist das Geschirr nass und kalt. Spülprogramm läuft in normaler Zeit ab, aber ohne zu heizen.
Es wird kein Fehler in den Fehlerspeicher geschrieben.

Ursache Heizung im Zeolithbehälter hat Masseschluss

- Abhilfe:**
1. Steckkontakt der Zeolithheizung am Leistungsmodul abstecken.
 2. Zeolithheizung auf Masseschluss prüfen (Isolationswiderstand > 1 MOhm)
 3. Bei defekter Zeolithheizung den Zeolithbehälter mit Heizung tauschen.

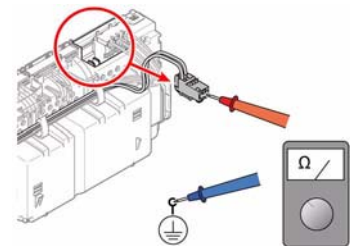

IGV / IGVS 6610... - Appliance with Zeolite unit does not heat

Fault: *After the end of program, the dishes are wet and cold. The program runs in normal time, but without heating.
The error memory shows no error code.*

Cause *Zeolite heating has ground fault.*

- Solution:**
1. *Disconnect the zeolite heater plug contact on the power module.*
 2. *Test zeolite heating to ground fault (insulation resistance > 1 MOhm)*
 3. *If zeolite heater is defective, exchange the zeolite container with heating.*

