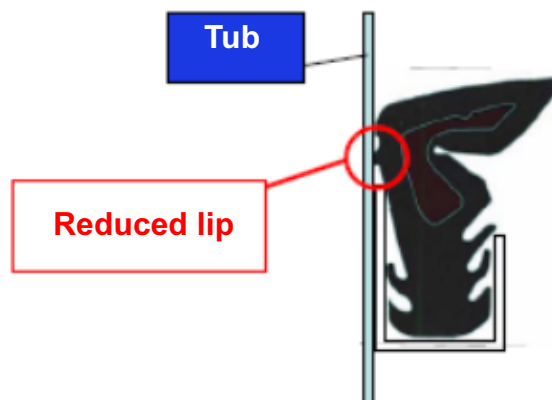


**Top dishwasher basket scrapes on the outer door
New outer door seal spare-part no. 426976**

We wish to inform you that a new outer door seal has been implemented for all of the 60 cm dishwashers produced as of March 2007 (series no. 710xxxxx). The modification involves reduction of the lip which makes contact with the wall of the tub (see illustration).

Models affected: All the DIVA 60 cm models, whose PNC begins at 911 9xx xxx.

**Spare parts**

	Spare-part. no.
Old seal	426 367
New seal	426 976

Replaceability

The new outer door seal must be used for technical modifications to appliances whose series no. is before 710xxxxx due to interferences between the top basket rail and the outer door seal.